

PRECISION MEASURING TOOLS


DIGITAL SCRIBING VERNIER CALIPER

Thank you for purchasing Niigata Seiki DIGITAL SCRIBING VERNIER CALIPER.

This product is a precision gauge for measuring and accurate scribing from the edge of the workpiece.

- For safe and proper use please read this instruction manual before use and follow the procedures described.
- Please keep manual where it is accessible to user for future reference.
- Keep this manual with the instrument if transferred or leased to a third party.
- For inquiries about this product please contact dealer or Niigata Seiki.

PART IDENTIFICATION & FUNCTION

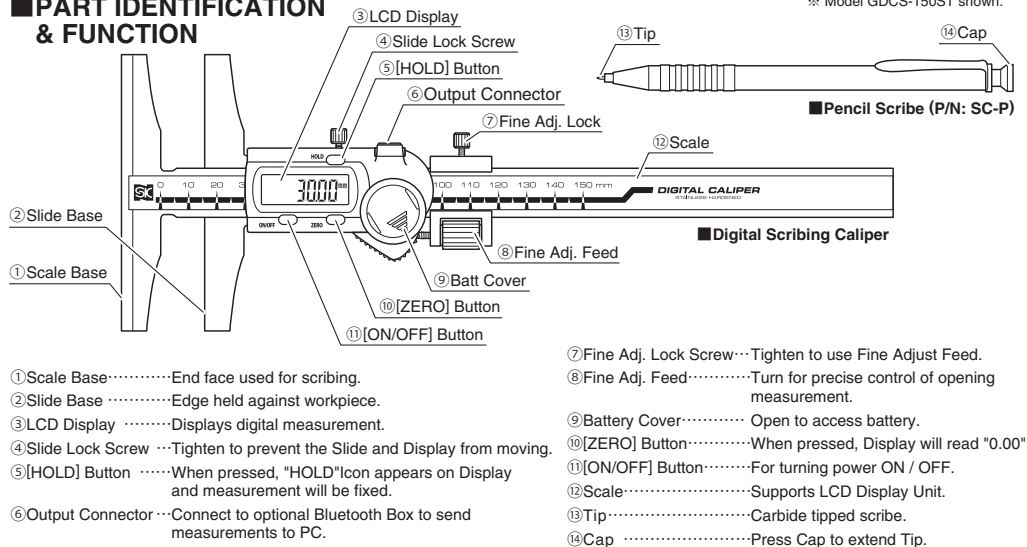

SAFETY PRECAUTIONS

Please Observe

To prevent harm to yourself or others, and to prevent damage to property, always follow the procedures marked by the following symbols.

⊘ Denotes a prohibition - You MUST NOT do

⊙ Denotes a requirement - You MUST do

⚠ WARNING: Indicates risk of **personal injury** or **property damage** if not followed.

- ⊙ **Read the manual and follow the directions.**
 - Use of product other than as described in this manual may cause accident.
- ⊙ **Use only for layout work.**
 - Use for any purpose other than as intended may damage or wear the instrument. Improper use may also cause accident.
- ⊙ **Handle with Care.**
 - Do not drop or subject instrument to excessive shock.
 - Do not place under heavy objects. Improper handling may cause damage or poor accuracy.
 - Do not scratch surface of instrument.
- ⊙ **Avoid using in high electric fields, such as near fluorescent lights or switching power supplies.**
 - Incorrect value may be displayed on LCD.
- ⊙ **Use and store only in environment meeting these conditions:**
 - Dry location protected from rain, water, and oils.
 - Location that is not excessively hot.
 - Location protected from use by children and unauthorized people.
 - Use in places contrary to the above may cause damage to the product resulting in accident or injury.
- ⊙ **Scribe tip is sharp — Handle With Care.**
 - Careless handling may cause injury.
- ⊙ **Do not disassemble or modify.**
 - Disassembly may damage product or cause accident. For repair, please contact distributor or place of purchase.
- ⊙ **Do not write on instrument with electric engraver.**
 - Do not engrave instrument body or base, such as an ID number with engraver or electric pen.

PREPARATION FOR USE

Before using, please follow the steps below:

- **Wipe off rust proofing and dirt from measuring surfaces and slide.**
 - Contamination of surfaces may cause measurement error.
- **Allow the Gauge and workpiece time to reach the same temperature.**
 - A temperature difference between the workpiece and the gauge may cause measurement error. Allow time for the temperatures to equilibrate.


BATTERY

- ① Slide cover in direction of arrow.
- ② Insert battery with (+) side facing out.
- ③ Replace battery cover.

⚠ Notice Use only CR2032 type battery.

● **Use care to avoid damaging terminals when inserting battery.**

- Terminals may be broken if battery is pressed straight down.
- Insert battery at angle, underneath the small hook, as shown.

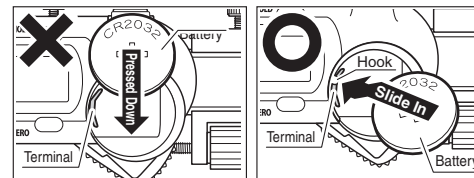

TROUBLESHOOTING

Q. Nothing is displayed on LCD.

- A. The battery may be running low, please replace battery with a new one.

Q. With power on, the number on the LCD does not change as Display Unit is moved.

- A. Please reset by removing battery for about 30sec., and then replacing.

Q. Nothing happens when buttons are pressed.

- A. Make sure battery is properly inserted.

Q. The characters "MIN", "MAX", or "△" are displayed on LCD.

- A. Cycle power, or apply several long presses to [HOLD] Button. Use as normal once character is off.

Q. The correct value is not displayed.

- A. High humidity may cause dampness. Please dry off the instrument and use only in dry location.

SERVICE

- If instrument is not working properly, or if you have any questions, please contact distributor or place of purchase.
- Please note, manufacturer is unable to respond to inquiries or provide service directly. Please contact distributor or place of purchase.

SPECIFICATION

Model No.	Measurement Range (mm)	Maximum permissible error*	Base Parallelism (mm)	Weight (g)
GDCS-150ST	0-150	±0.07	0.07	295
GDCS-300ST	0-300	±0.08	0.08	360

※Not including quantization error (±1 count)

- Resolution : 0.01mm
- Display : 5 Digit LCD
- Auto Off : approx. 20 min.
- Maximum response speed : Slide to Right 1.5 m/s
Slide to Left 0.75 m/s
※Left/Right as shown in diagram at top of manual.
- Operating Temperature Range : 0°C~40°C
- Storage Temperature Range : -10°C~60°C
- Power : (1x) CR2032 Lithium Battery
- Battery Life : approx. 2.5 years in normal use.
- Accessory : CR2032 Lithium Battery (for test)

HOW TO USE


■ **Power ON/OFF**

- ① To turn ON, press the [ON/OFF] Button.
- ② To turn OFF, press the [ON/OFF] Button.
- ③ With power ON, press [HOLD] Button to fix the value on the display.

■ **Zero Point Setting**

- ① Turn power ON and loosen the Slide Lock Screw.
- ② Place the Scale Base on a flat surface, and push the Slide Base down. (Fig. 1)
- ③ With both Bases flat against surface, press the [ZERO] Button. (Fig. 2)

When the Display reads "0.00mm", the Zero Point has been set.

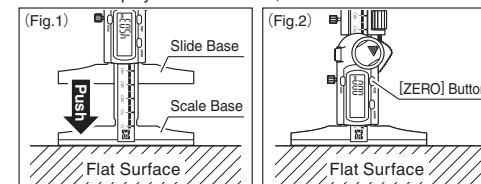

■ **Scribing**

- ① Open the gauge the distance you want to scribe.


※For precise setting of position use the Fine Adjust Carriage by loosening the Slide Lock Screw, tightening the Fine Adjust Lock Screw and turning the Fine Adjust Feed until position is set.

※Please note, Fine Adjust Carriage will come loose if turned too far.

- ② Tighten the Slide Lock Screw when set to the desired distance.

- ③ If the Scribe Tip is not extended, press on the Cap to extend the Tip.

- ④ Place the Slide Base against the Workpiece, and scribe along the Scale Base using the Pencil Scribe. (Fig. 3)

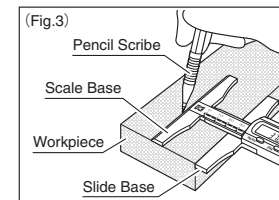

■ **Using the Scribe**

- Keep the Scribe as upright as possible to reduce chipping and damage to surface from low angle scribing.
- When Scribing, do not tilt the Scribe more than 45°
- Scribe in one clean stroke from top of line, and do not retrace line once scribed
- Replacement tips are available separately. (P/N: SC-PE5)

AFTER USE CARE • STORAGE

- **After use, wipe off any dirt or oil from measuring surfaces, sliding surfaces, and exterior using a dry cloth and perform rust prevention treatment.**
For rust prevention, lightly apply anti-rust oil, or place in rust preventive bag.
- **Store with Lock Screws loosened.**
If stored with Lock Screws tight, expansion due to temperature changes may cause excessive force which will cause inaccuracy.
- **Store in the provided case in a cool, dry, and dark location.**
Keep out of direct sunlight and moisture, and please keep secure from unauthorized personnel.
- **Remove battery if instrument will not be used for a long period of time.**
Batteries may leak if left in unused instrument for an extended period.


精密測定工具 デジタルケガキゲージ

この度は「デジタルケガキゲージ」をお買上げいただきありがとうございます。
この商品は、副尺のベースを基準に測定し、本尺のベース端面で正確なケガキ作業ができるゲージです。

- 正しく安全にお使いいただくため、ご使用前に本取扱説明書を必ず読み、記載の順に従ってご使用ください。
お読みになった後は、お使いになる方がいつでも見ることが出来る場所に大切に保管してください。
- 第三者に譲渡・貸与される場合も、この説明書を必ず添付してください。
- 当商品に関するお問い合わせは、お買い求めの販売店もしくは当社にご連絡ください。

■各部の名称と機能

※イラストはGDCS-150STです。

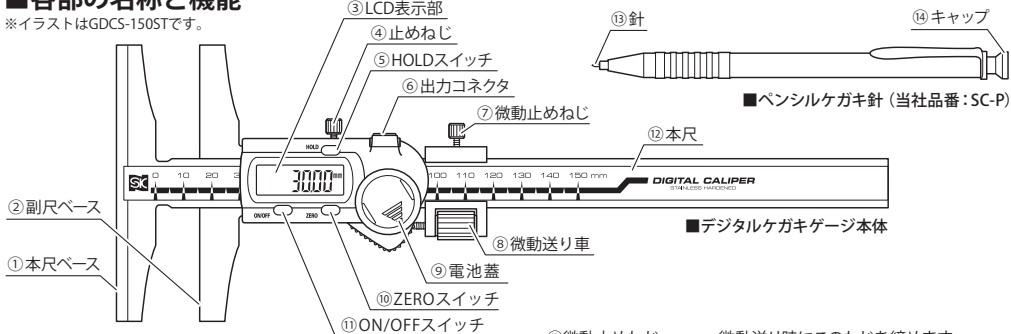

- ①本尺ベース …… この端面に沿ってけがきます。
- ②副尺ベース …… この端面をワークの端面に当てます。
- ③LCD表示部 …… 測定数値をデジタル表示します。
- ④止めねじ …… デジタル液晶部のスライドを固定します。
- ⑤HOLDスイッチ …… 押すと画面上に"HOLD"と表示され、表示している数値を固定できます。
- ⑥出力コネクタ …… 別売の Bluetooth BOX を接続することで、測定値をパソコンへ出力することができます。

- ⑦微動止めねじ …… 微動送り時にこのねじを締めます。
- ⑧微動送り車 …… 微動送り時にここを回して、開き幅の微調整を行います。
- ⑨電池蓋 …… 開けて電池をセットします。
- ⑩ZEROスイッチ …… 押すと画面に"0.00"が表示されます。
- ⑪ON/OFFスイッチ …… 電源のON/OFFを行います。
- ⑫本尺 …… デジタル液晶部のスライドを保持します。
- ⑬針 …… 先端超硬チップ付のケガキ針です。
- ⑭キャップ …… ノックして針の出し入れを行います。

安全上のご注意 必ずお守りください

お使いになる人や他の人への危害、財産への損害を未然に防止するため、必ずお守りいただくことを右記のように説明しています。

⊘ してはいけない内容
『禁止事項』です。

⊙ 必ず実行していただく
内容『強制事項』です。

⚠ **注意** お守りいただかないと『傷害を負う、または物的損害が発生するおそれがある内容』です。

- ⊙ **取扱説明書をよく読み、指示に従う。**
 - ・取扱説明書に記載された内容以外での使用は、事故の原因となります。
- ⊙ **測定作業にのみ使用する。**
 - ・指定用途以外へのご使用は、製品の破損や磨耗、予測できない事故の原因となります。
- ⊙ **大切に取り扱い扱う。**
 - ・ぶつける、落とすなどの衝撃を与えたり、重量物を上に乗せたりしないでください。精度不良や破損の原因となります。
 - ・商品に傷をつけないでください。
- ⊙ **インパータ式蛍光灯などの電界が発生する場所での使用は避ける。**
 - ・LCD表示部の数値が誤作動を起こす原因となります。
- ⊙ **下記の条件を満たす環境で使用・保管する。**
 - 雨や水、油などがつかからない、乾燥した場所
 - 高温にならない場所
 - 子どもや、使用者以外が近付かない場所
 - ・上記に反する場所での使用は製品の破損、事故やけがの原因となります。
- ⊙ **ケガキ針先端は尖っているので、扱いに注意する。**
 - ・けがの原因となります。
- ⊙ **分解・改造を行わない。**
 - ・製品の破損や事故の原因となります。修理はお買い上げの販売店、または発売元までご連絡ください。
- ⊙ **電気ペンなどで書き込まない。**
 - ・電気ペンなどで本尺やベースなどに、番号などの書き込みをしないでください。


使用前の準備 ご使用前に、下記の準備を行ってください

- 測定面、摺動面、外観などの汚れや防錆油などを拭き取る
そのまま測定を行うと誤差の原因となります。
- 本体と被測定物の温度慣らしを十分に行う
測定器本体と被測定物の間に温度差があると、誤差の原因となります。同じ温度になるよう、温度慣らしは十分に行ってください。

電池のセット・交換


- ①電池蓋を矢印の向きに外します。
- ②電池を、必ず(+)側を表にしてセットしてください。
- ③電池蓋を元通りに装着してください。

⚠ **ご注意** 電池は必ずCR2032をお使いください。

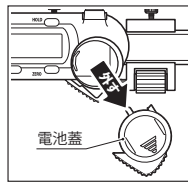

●電池をセットする際は、端子の折れにご注意ください。

- ・電池をセットする際に上から強く押し込むと、端子が折れて破損する場合があります。
- ・電池をセットする際は、右斜め方向から端子を外側に押すように、本体のツメの下へ入れ込んでください。

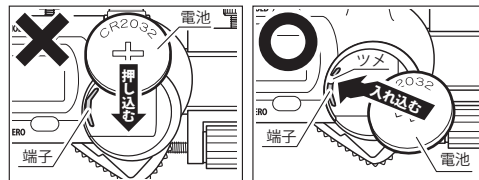

トラブルと対応

Q. LCD表示部に何も表示されない。

- A. 電池の残量が少なくなっている可能性があります。新しい電池と交換してください。

Q. 電源ONの状態でもスライドさせてもLCD表示の数字が変わらない。

- A. 一度電池を取り外し、30秒後に電池をセットし直してください。

Q. スイッチを押しても何も反応しない。

- A. 電池が正しくセットされているか確認してください。

Q. LCD表示部に『MAX』『MIN』『△』などの文字が表示されている。

- A. 一度電源を切るか、“HOLD”スイッチを何回か長押しして文字を消してからご使用ください。

Q. 正しい数値が表示されない。

- A. 使用環境の湿度が高い可能性があります。本器を乾燥させ、湿度が低い環境下でご使用ください。

修理の際は

- 正常に作動しない場合や、不明な点がございましたらお買い上げの販売店または、発売元までご連絡ください。
- お問い合わせや、ご連絡が無いまま直接発売元に修理品などを送付されても処理、対応ができない場合がありますのでご了承ください。

製品仕様

品 番	測定範囲 (mm)	最大許容誤差* (mm)	ベースの 平行度(mm)	本体質量 (g)
GDCS-150ST	0-150	±0.07	0.07	295
GDCS-300ST	0-300	±0.08	0.08	360

※量子化誤差(±1カウント)含まず

- ・最小読取值：0.01mm
- ・表 示：LCD 5桁表示
- ・オートオフ：約20分
- ・最大応答速度：右方向へのスライド…1.5m/s
左方向へのスライド…0.75m/s
※右方向、左方向は各部の名称の図を正面にした場合
- ・使用温度範囲：0℃～40℃
- ・保存温度範囲：-10℃～60℃
- ・電 源：リチウム電池 CR2032×1
- ・電池寿命：通常使用状態で約2.5年
- ・付 属 品：リチウム電池 CR2032 (テスト用)



使用方法

■電源のON/OFF

- ①電源をONにするには、“ON/OFF”スイッチを押してください。
- ②電源をOFFにするには、“ON/OFF”スイッチを押してください。
- ③電源ONの状態から“HOLD”スイッチを押すと数値が固定されます。

■0点合わせ

- ①止めねじをゆるめ、電源を入れてください。
- ②平らな面に本尺ベースを当て、副尺ベースを押し下げてください。(図1)
- ③副尺ベースが平らな面に当たった所で“ZERO”スイッチを押してください。(図2)
LCD表示部に“0.00mm”が表示されると0点合わせが完了です。

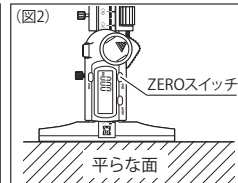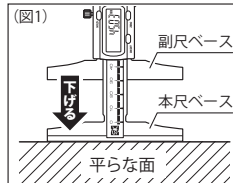


■ケガキ作業

- ①けがきたい幅に本尺ベースと副尺ベースの間を開きます。

※開き幅の微調整には微動送り車を使うと便利です。止めねじをゆるめ、微動止めねじを締めた状態で微動送り車を回して微調整を行ってください。
※微動送り車は回しすぎると外れますのでご注意ください。

- ②止めねじを締めて幅を固定してください。
- ③付属のペンシルケガキ針の針が出ていない場合は、キャップを押して針を出してください。
- ④ワークの端面に副尺ベースを当て、ペンシルケガキ針で本尺ベースに沿ってけがしてください。(図3)

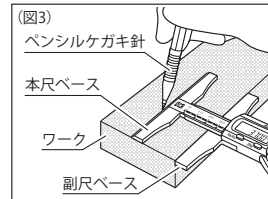

■付属のペンシルケガキ針について

- 斜めケガキによるチップ欠落や、破損防止のため、できるだけ垂直に立ててけがいてください。
- ケガキ（線引き）中は、45°以上倒さないでください。
- 一度けがいた上から、二度引きしないでください。
- 替針も別売しております。(当社品番：SC-PE5)

使用後のお手入れ・保管方法

- 測定面・摺動面・外観などの汚れや油などを乾いたウエスで拭き取り、防錆処理を行う
防錆処理は防錆油を薄く塗るか、防錆袋などに入れてください。
- 止めねじをゆるめた状態で保管する
止めねじを締めて固定すると、温度変化による膨張などで無理な力がかかり、精度不良の原因となります。
- 付属のケースに入れ、乾燥した冷暗所に保管する
直射日光や湿気は避け、管理者以外が触れない状態で保管してください。
- 長期間使用しない場合は電池を製品から取り外した状態で保管する
長期間使用しないで放置すると、電池の液漏れの原因となります。